# STUDIES OF ALKALI METAL CORROSION ON MATERIALS FOR ADVANCED SPACE POWER SYSTEMS

QUARTERLY PROGRESS REPORT 5

Covering the Period

June 26, 1965 to September 26, 1965

Written by

R. W. Harrison

Approved by
J. W. Semmel, Jr.
Manager, Materials and Processes

Prepared for
NATIONAL AERONAUTICS AND SPACE ADMINISTRATION
Contract NAS 3-6012

Technical Management

NASA - Lewis Research Center

Mr. R. L. Davies

SPACE POWER AND PROPULSION SECTION
MISSILE AND SPACE DIVISION
GENERAL ELECTRIC COMPANY
CINCINNATI, OHIO 45215

## CONTENTS

| Section |  | Page |
|---------|--|------|
| I       | INTRODUCTION                                       | 1    |
| 11      | SUMMARY:   | 4    |
| III     | TASK I - STRESS CORROSION REFLUX CAPSULE TESTS     | 5    |
|         | D-43 Alloy Stress Corrosion Reflux Capsule Test I  | 5    |
|         | D-43 Alloy Stress Corrosion Reflux Capsule Test II | 13   |
| IV      | TASK II - BIMETALLIC ISOTHERMAL CAPSULE TESTS      | 16   |
| v       | FUTURE PLANS                                       | 19   |
|         | REFERENCES   | 20   |
|         | DISTRIBUTION LIST                                  | 21   |

## LIST OF ILLUSTRATIONS

| Figure |   | Page |
|--------|---|------|
| 1      | D-43 Alloy Stress Corrosion Reflux Capsule I After 1000 Hours of Testing at $2100^{\circ}$ F in a Vacuum of 1.2 x $10^{-8}$ Torr and Prior to Removal of the Contained Potassium    | 6    |
| 2      | Biaxial Creep Data on the D-43 Alloy Stress Corrosion Reflux Capsule Test I - 1000 Hours Exposure to Potassium  | 7    |
| 3      | Pressure-Time Measurements for the D-43 Alloy Stress Corrosion Reflux Capsule Test I  | . 8  |
| 4      | Sectioned D-43 Alloy Stress Corrosion Reflux Capsule I After a 1000-Hour Exposure to Potassium at 2100°F  | 9    |
| 5      | The ID Surface of D-43 Alloy Stress Corrosion Reflux Capsule I After a 1000-Hour Exposure to Potassium at 2100°F. Spots can be Observed at Both the Thick and Reduced Wall Sections | 10   |
| 6      | Creep Properties of D-43 Alloy at 2100°F  | 14   |
| 7      | High-Vacuum Creep-Rupture Facility Capable of Achieving a Pressure of 10 <sup>-10</sup> Torr and Incorporating a 100 Liter/Sec Getter-Ion Pump                                      | 15   |
| 8      | Biaxial Creep Data on the D-43 Alloy Stress Corrosion Reflux Capsule Test II - 1600 Hours Exposure to Potassium   | 18   |
|        | LIST OF TABLES  |      |
| Table  |   | Page |
| I      | Capsule Preparation and Cleaning Procedure  | 12   |
| 11     | Spectrographic Analysis of the Potassium Used to Fill the D-43  | 177  |

## I. INTRODUCTION

The program reviewed in this fifth quarterly progress report, covering the period from June 26, 1965 to September 26, 1965, is sponsored by the National Aeronautics and Space Administration. Its purpose it to examine the influence of stress on the corrosion behavior of an advanced refractory alloy in potassium (Task I) and to investigate corrosion mass transfer effects in a stainless steel - columbium alloy - potassium system (Task II).

## Task I

While there is considerable evidence that refractory alloys have excellent corrosion resistance to potassium, there are few experiments which describe the possible effects of stress on corrosion when the stress is sufficiently large to produce substantial amounts of creep during the test. It is appropriate for comparative purposes to study an advanced refractory alloy which has demonstrated excellent corrosion resistance to refluxing potassium during long-time exposures conducted at relatively low stresses at 2000°F. In this regard, D-43 columbium base alloy, in the form of welded capsules, has been tested in potassium under refluxing conditions for periods of 5000 and 10,000 hours at temperatures on the order of 2000°F (1) and has been selected for inclusion in this program.

The D-43 alloy reflux capsules shall be tested under conditions which result in about 5 to 10% strain during a 500- to 2000-hour exposure period in the 2000° to 2200°F temperature range. The reflux capsules used in this study will be of similar size to those previously described (1). The capsule wall shall be reduced in the potassium liquid region and in the vapor condensing region to

provide gauge sections where the extent of creep can be measured. Moderate temperature adjustment can be made during the test to achieve the desired strain-time conditions.

## Task II

The use of stainless steel, rather than refractory alloys, for power plant radiator construction and for the lower temperature portion of experimental facilities constitutes material and fabrication cost savings. Two methods of employing this approach are: use of co-extruded, stainless steel shell-refractory alloy core, tubing in the radiator or use of an all stainless steel radiator joined to the system by a bimetallic joint. Although the latter approach is preferred considering cost and problems associated with fabrication and joining of co-extruded tubing, a major uncertainty and limitation arises from the mass transfer of interstitial elements from the stainless steel to the refractory alloys through the alkali metal.

It is well established that the carbon and nitrogen transfer from Type 316SS to Cb-1Zr alloy at temperatures near 1500°F (2). While some important aspects of this mass transfer behavior have been examined, several critical details require additional investigation. There is a need to define acceptable time and temperature conditions of operation in terms of maintaining satisfactory performance of the refractory alloys, such as Cb-1Zr alloy. Also, there are certain metallurgical aspects of this behavior which should be investigated in an effort to eliminate or reduce the mass transfer rate. In the latter category, it is most appropriate to consider the stabilization of carbon and nitrogen in the stainless steel by the addition of metallic elements which form carbides and nitrides of high thermodynamic stability. Commercially

available, titanium stabilized, Type 321SS is one such alloy. A comparative investigation of this alloy and Type 316SS was performed to indicate the ability of the titanium addition to reduce or eliminate interstitial mass transfer in a stainless steel Cb-1Zr alloy bimetallic system. Columbium-1% zirconium alloy specimens were exposed to liquid potassium in Type 321SS and Type 316SS capsules for 1000 hours at 1400°F under isothermal conditions to evaluate this premise. Post-test evaluation showed that Type 321SS has a significant advantage over Type 316SS in refractory metal-stainless steel-potassium system in inhibiting mass transfer of the interstitial elements carbon and nitrogen from the stainless steel to the refractory metal.

#### II. SUMMARY

During the fifth quarter of this program, the topics abstracted below were covered. The results are interpretatively presented in this report.

## Task I - Stress Corrosion Reflux Capsule Tests

The D-43 Alloy Stress Corrosion Reflux Capsule Test I completed 1000 hours of testing at a nominal temperature of 2100°F and was removed from the test facility. Equivalent uniaxial creep strains of 7.4% in the liquid region and 5.4% in the condensing region were calculated from the expansion data. The capsule was drained of potassium, cleaned and sectioned. Although examination of the inner surface of the capsule revealed the presence of spots in the liquid and condensing regions, further investigations indicated no association between the location of the spots and the regions of high stress. Lower uniaxial creep strengths were obtained from capsule test data than were predicted by pretest and literature data. Additional uniaxial creep tests are planned in expectation of explaining this anomally.

The D-43 Alloy Stress Corrosion Reflux Capsule Test II continues on test at a nominal temperature of 2050°F. A total of 1600 hours of test time has been accumulated.

## Task II - Bimetallic Isothermal Capsule Tests


A Topical Report has been written on Task II and will be submitted to the NASA Technical Manager for review during the next reporting period.

#### III. TASK I - STRESS CORROSION REFLUX CAPSULE TESTS


## D-43 Alloy Stress Corrosion Reflux Capsule Test I

Capsule Test I completed 1000 hours of exposure at a nominal temperature of 2100°F without difficulty. Subsequently, the capsule was removed from the test facility and examined, Figure 1. Luders lines were apparent on the expanded liquid and condensing regions as previously evidenced in the preliminary capsule test. The diametral expansion was checked with a micrometer and proved to be in excellent agreement with that indicated in the LVDT measurements. As an example, the 0.0896-inch diametral change measured in the liquid region by the LVDT's, measured 0.088-inch with the micrometer. This represents an LVDT accuracy of better than ± 2%. Total equivalent uniaxial creep strains of 7.4% in the liquid region and 5.4% in the condensing region were calculated from the diametral change. The creep curves plotted from the LVDT data are depicted in Figure 2. The lower creep strain measured in the condensing region results partially from the 15°-20°F lower temperature in the condensing region over that which was measured in the liquid region. The pressure-time data for Capsule Test I is shown in Figure 3.


The capsule was opened and drained of potassium in an argon atmosphere. Subsequently, the capsule was cleaned by vacuum distillation at a temperature of about 600°F and a pressure of 5 x 10<sup>-5</sup> torr and was sectioned, Figure 4. Spots were observed on the ID surface of the capsule and are shown at higher magnification in Figure 5. The fact that these spots appear in the thick-wall section of the capsule as well as in the reduced-wall section suggests their presence is not dependent upon the existance of high stress. Similar spots

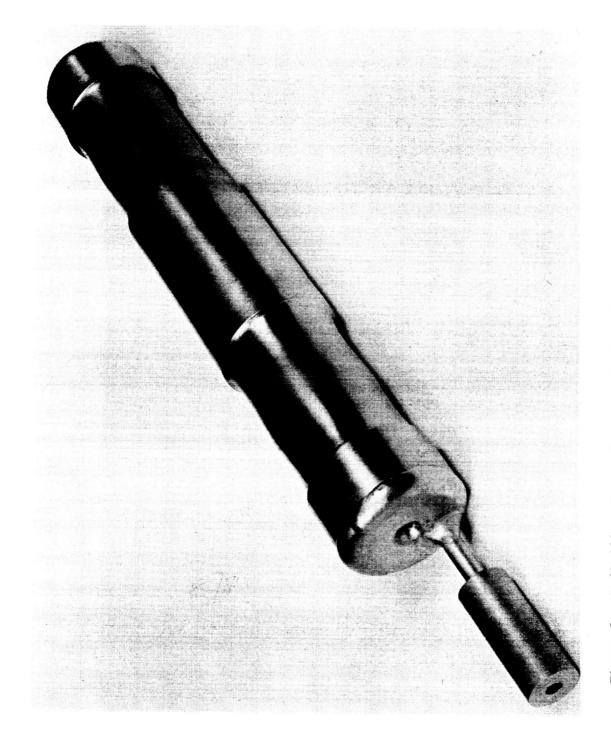

D-43 Alloy Stress Corrosion Reflux Capsule I After 1,000 Hours of Testing at  $2100^{\circ}F$  in a Vacuum of 1.2 x  $10^{-8}$  Torr and Prior to Removal of the Contained Potassium. Figure 1.

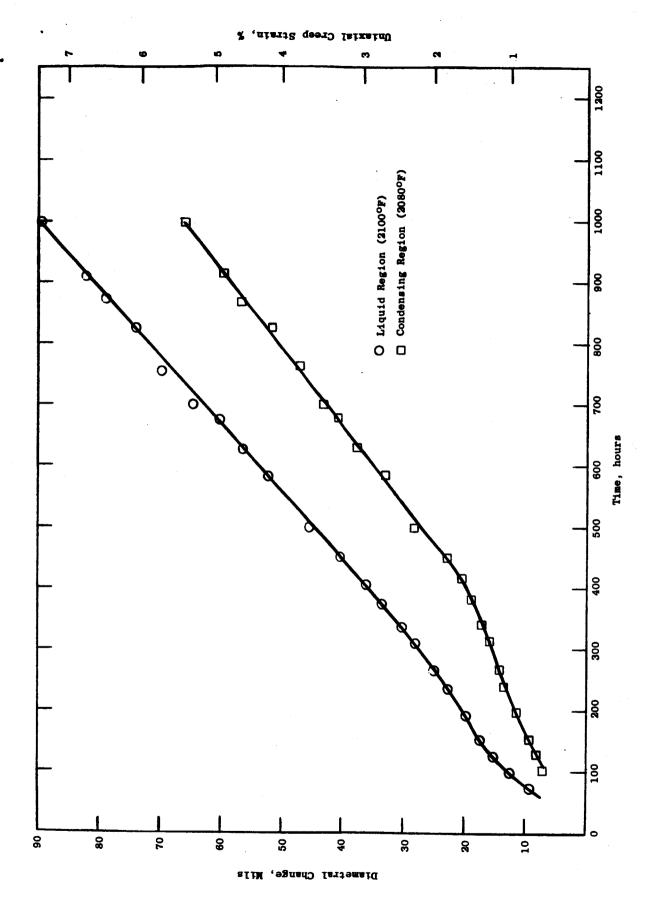

Biaxial Creep Data on the D-43 Alloy Stress Corrosion Reflux Capsule Test I - 1,000 Hours Exposure to Potassium. Calculated Uniaxial Stress-6100 psi. Figure 2.

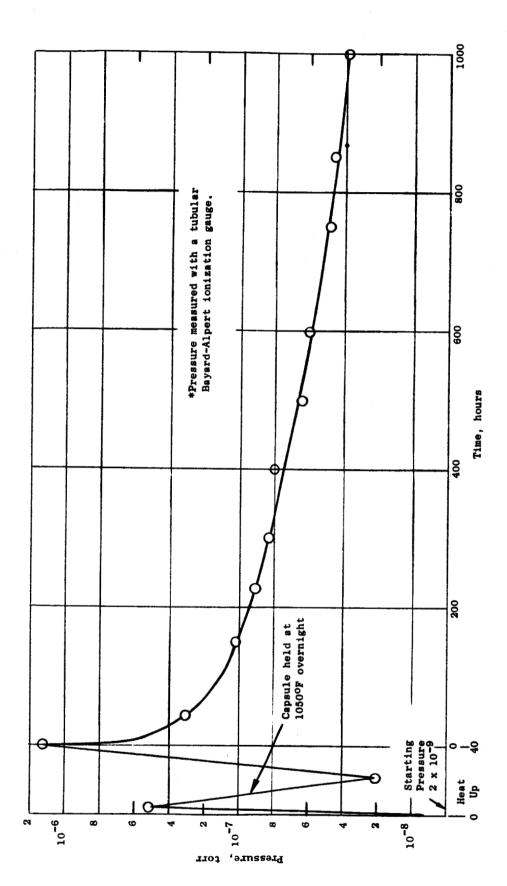

Pressure-Time Measurements for the D-43 Alloy Stress Corrosion Reflux Capsule Test I.\* Figure 3.

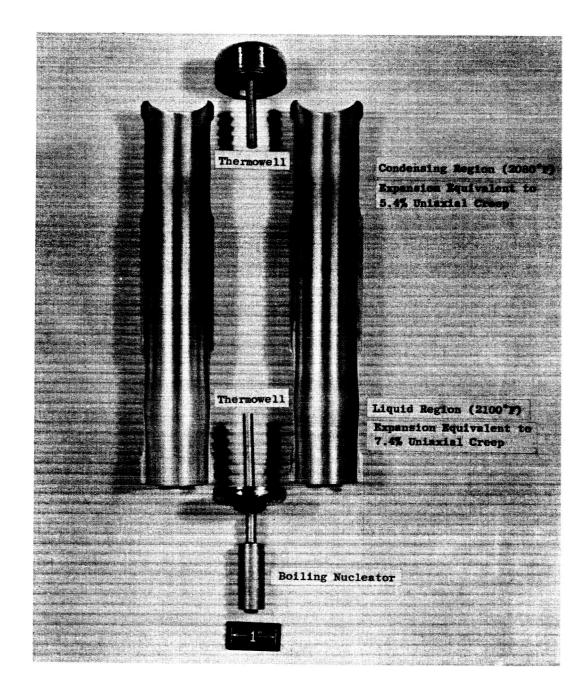


Figure 4. Sectioned D-43 Alloy Stress Corrosion Reflux Capsule I After a 1,000-Hour Exposure to Potassium at 2100°F.


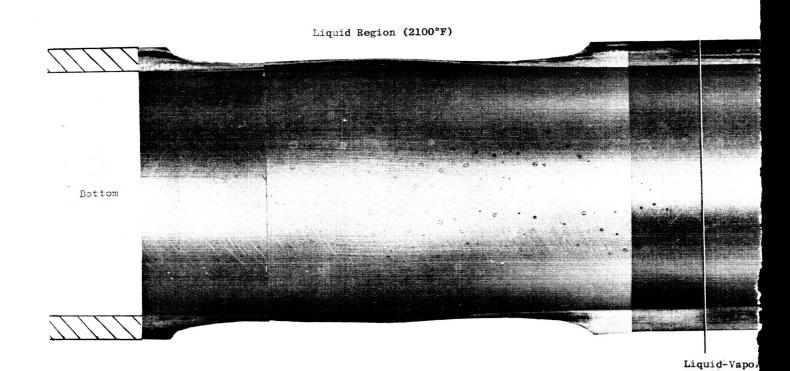


Figure 5. The ID Surface of D-43 Alloy 1000-Hour Exposure to Potassi Both the Thick and Reduced Wa.

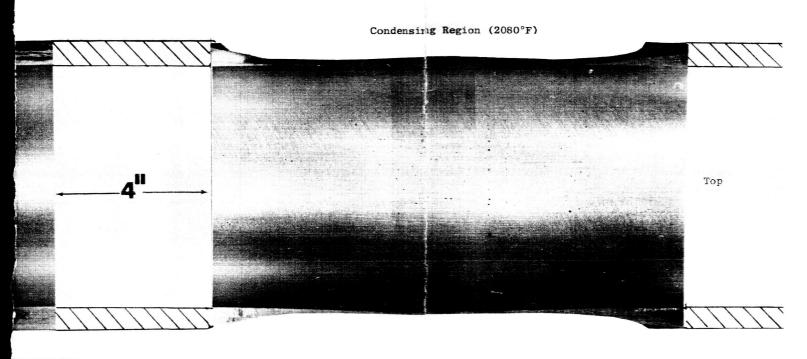

Interface

9.71"

Stress Corrosion Reflux Capsule I After a um at 2100°F. Spots can be Observed in 11 Sections. Mag. 3X

were observed in the condensing region of the preliminary capsule test (3). However post-test evaluation of D-43 alloy capsule tested previously for 5000 and 10,000 hours did not delineate spots. Therefore, in an effort to explain this anomally, a study of the capsule preparation and cleaning procedures employed in recent capsule tests at General Electric was made. The results of this study are shown in Table I.

The 5000 and 10,000-hour D-43 capsules were post-test cleaned by draining and reacting the residual potassium with ethanol in hexane. This procedure was found to be less desirable than vacuum distillation as the ethanol reaction with potassium can result in hydrogen pickup in the refractory alloys (4). As a result, succeeding capsules, including those in this study, were cleaned by vacuum distillation. No spots were observed in the Cb-1Zr capsules containing Mo-TZM insert specimens which were cleaned by vacuum distillation without prior draining (5). In order to remove this one variable, the D-43 Stress Corrosion Reflux Capsule Test II presently on test, will be cleaned by the ethanol-hexane technique\*. Any hydrogen pickup resulting from this cleaning procedure will not jeopardize the post-test evaluation of this capsule as mechanical property tests are not planned.

<sup>\*</sup>On October 14, 1965, D-43 Alloy Reflux Capsule Test II completed 2000 hours of testing at 2050°F. The capsule was removed from the test facility and placed in the E.B. Welding Chamber. Subsequent to evacuating the chamber to 1 x 10<sup>-5</sup> torr and back filling with bottle argon containing less than 3 ppm oxygen, the capsule was opened, drained of potassium, and cleaned by reacting the residual potassium with ethanol in hexane. Subsequently, the capsule was sectioned and examined. No spots were noted on the capsule ID. This finding suggests that the presence of spots in the previous capsules tested in this program was a function of cleaning procedure and not due to potassium exposure in testing. The mechanism by which these spots formed during vacuum distillation after draining the capsule is not completely understood at this time.


TABLE I. CAPSULE PREPARATION AND CLEANING PROCEDURES

| Observations                |  | Spots on ID  | ŧ  | 1                  | No Spots<br>Observed   | No Spots<br>Observed  |
|-----------------------------|--|--|--|--------------------|--|---|
| Post-Test<br>Cleaning       |  | Drain & Vacuum<br>Distillation<br>600°F & 5 x 10-4<br>Torr | Ξ  | On Test            | Drain & React<br>with Hexane &<br>Ethanol  | Vacuum Distillation<br>Without Draining<br>800°F x 5 x 10<br>Torr |
| Post-Weld<br>Heat Treatment |  | None   | l Hour @ 2400°F<br>10-6 Torr, Double<br>Wrapped in Cb-1Zr Foil | :                  | 1 Hour @ 2400°F<br>10 <sup>-5</sup> Torr, Not<br>Wrapped                               | None  |
| Pretest Cleaning            |  | Vapor Degreased*<br>Ethanol Wash<br>Air Dry                |  | τ                  | Pickle HNO <sub>3</sub> -HF-H <sub>2</sub> O,<br>Water Rinse, Ethanol<br>Wash, Air Dry | Enthanol Wash, Air<br>Dry   |
| Fabrication                 |  | Machined<br>16 rms<br>Finish on ID                         | :  | ±                  | Rolled & Welded Sheet  | Gun Drilled &<br>Honed to 32<br>rms                               |
| Raw Material                |  | Bar<br>Recrystallized<br>I Hour @ 2600°F                   | Ξ  | Ξ                  | Sheet Stress-<br>Relieved 1 Hour<br>@ 2200°F   | Cb-1Zr Tubing   |
| Capsule Test                | I. D-43 Alloy Stress<br>Corrosion Capsules | A. Preliminary Test  | B. Capsule Test I  | C. Capsule Test II | <pre>II. D-43 Alloy Capsule    Tests<sup>11</sup>£000 &amp; 10,000    Hours)</pre>     | III, Mo-TZM-Cb-1Zr Capsule Cb-1Zr Tubing (2500 & 5000 Hours)      |

\* Thermowells and Caps were not Vapor Degreamed but Cleaned in Ethanol and Dried. Spotswere Observed on these Pieces after Post-Test Cleaning.


As described previously (3), the uniaxial creep data obtained from pretest evaluation of the D-43 alloy used for capsule fabrication indicated a higher strength than that which was obtained in the actual capsule test. The capsule test data also indicated lower creep strengths than that reported in the literature (6). A graphical comparison of these data is shown in Figure 6. Pretest creep data were obtained with a 0.160-inch diameter gauge section on bulk type specimens in a facility capable of  $10^{-6}$  torr vacuum (7). An additional D-43 bulk specimen has been submitted for creep testing in a facility capable of  $10^{-10}$ torr vacuum, Figure 7. Results of this test should indicate if the higher pretest data were a function of test environment although post-test chemical analyses of those creep specimens indicated negligible contamination (7). effects of specimen geometry are also being investigated since the DMIC data were obtained on sheet specimens (6) and the capsule data were indicative of creep in a 0.020-inch thick wall section. As a result, 0.020-inch thick creep specimens have been machined from the 0.140-inch wall section of the D-43 alloy preliminary capsule for creep testing at 2100°F in a 10-8 torr vacuum. short time this capsule material was exposed at temperature (3) should not influence its metallurgical structure and the resulting strengths should be representative of the recrystallized D-43 alloy used to fabricate Capsule I. D-43 Alloy Stress Corrosion Reflux Capsule Test II

An additional stress corrosion reflux capsule was filled with sufficient potassium to produce a 5-inch liquid height at the test temperature ( $2050^{\circ}$ F). The potassium was transferred directly to the capsule from the final hot trapping container and the capsule was sealed by electron beam welding in a vacuum of  $8 \times 10^{-6}$  torr. The potassium that was used for filling the capsule

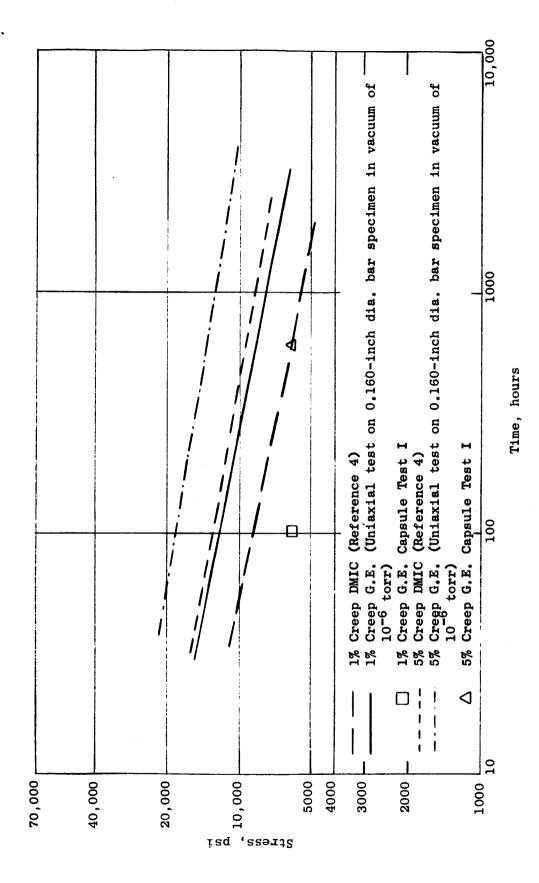

\*A complete comparison of data obtained in capsule tests and uniaxial creep tests will be reported in the topical report.

Figure 6. Preliminary Comparison of Creep Properties of D-43 Alloy at 2100°F.\*

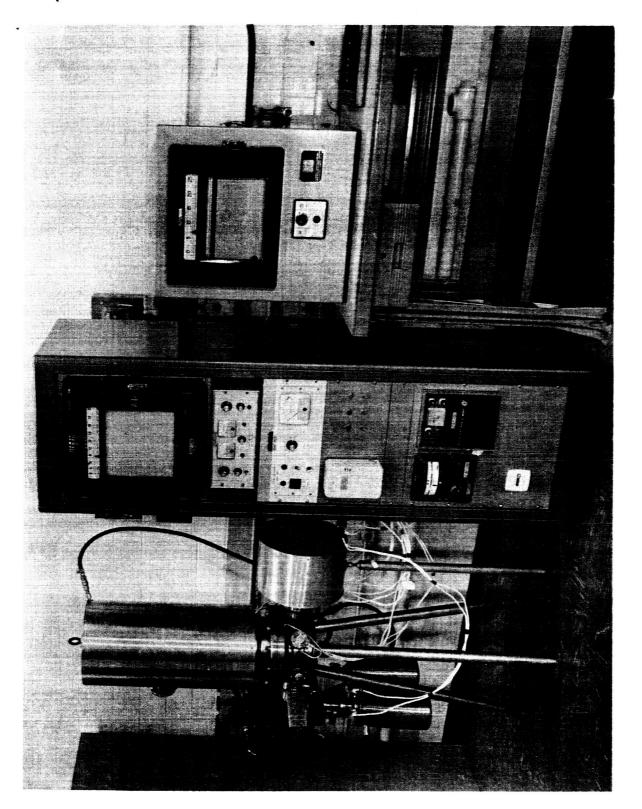

High-Vacuum Creep-Rupture Facility Capable of Achieving a Pressure of  $10^{-10}$  Torr and Incorporating a 100 Liter/Sec Getter-Ion Pump. Figure 7.

was sampled at the same time that the capsule was filled and was analyzed for oxygen by the mercury amalgamation method (helium cover gas); the results showed the oxygen in the potassium taken from the fill tube to be 6 ppm and the oxygen in the potassium taken from the chamber to be 11 ppm. Spectrographic analyses of this potassium and that used to fill Capsule I are presented in Table II. The filled and sealed capsule was examined radiographically to assure a sound electron beam weld and subsequently was installed in the test facility.

After a thorough instrumentation check, the LVDT's were calibrated and the system was closed and evacuated. Mass spectrometer leak checking indicated no leaks present and pre-bakeout vacuum of 8 x 10<sup>-8</sup> torr was achieved. The system was baked out at 350°C for six hours; on cooling, a vacuum of 1.5 x 10<sup>-9</sup> torr was measured with a tubular Bayard-Alpert ionization gauge in the chamber wall. Capsule testing was initiated on 7-22-65 and at the end of this reporting period 1600 hours of test time have been accumulated at a liquid region temperature of 2050°F. A vacuum of 1.2 x 10<sup>-8</sup> torr was recorded at that time. The creep data obtained to-date is depicted in Figure 8. As was the case in Capsule Test I, creep in the condensing region is less than that measured in the liquid region.


## IV. TASK II - BIMETALLIC ISOTHERMAL CAPSULE TESTS

A Topical Report has been prepared and will be submitted for NASA review within the next reporting period.

TABLE II. SPECTROGRAPHIC ANALYSIS OF THE POTASSIUM USED TO FILL THE D-43 ALLOY STRESS CORROSION REFLUX CAPSULES

|               | Analyses <sup>1</sup> , ppm |                 |  |  |
|---------------|-----------------------------|-----------------|--|--|
| Element       | Capsule Test I              | Capsule Test II |  |  |
| Ag            | <1                          | <1              |  |  |
| Al            | <1                          | 1               |  |  |
| Ве            | 1 6                         | <1              |  |  |
| Ca            | 1                           | >25             |  |  |
| Ср            | <1                          | < 5             |  |  |
| Co            | <1                          | <1              |  |  |
| Cr            | <1                          | <1              |  |  |
| Cu            | <1                          | <1              |  |  |
| Fe            | 1                           | <1              |  |  |
| Mg            | <1                          | 15              |  |  |
| Mn            | < 1                         | <1              |  |  |
| Мо            | <1                          | <1              |  |  |
| Na            | 1                           | 5               |  |  |
| Ni            | <1                          | <1              |  |  |
| Pb            | <1                          | <1              |  |  |
| Si            | 1                           | < 5             |  |  |
| Sn            | < 5                         | < 5             |  |  |
| Ti            | <1                          | <1              |  |  |
| v             | -                           | <5              |  |  |
| $\mathbf{Zr}$ | <b>&lt;</b> 5               | < 5             |  |  |

<sup>1</sup> As KC1

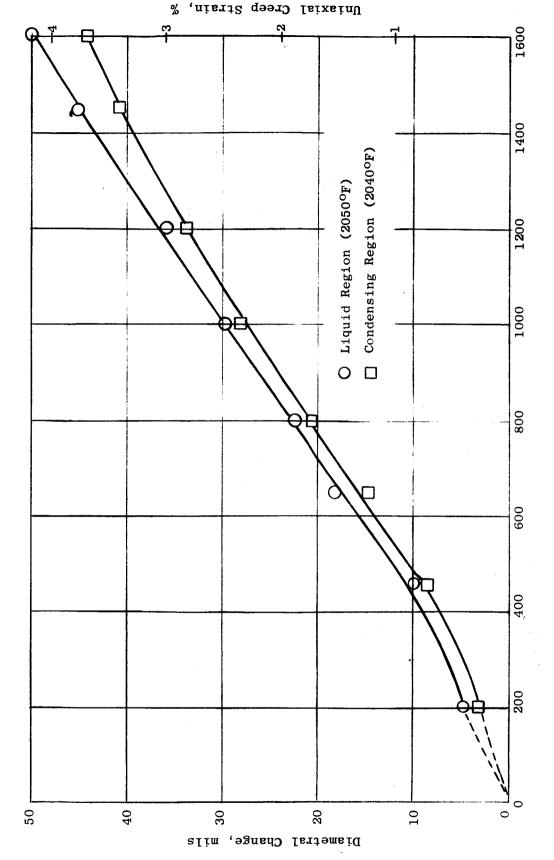

Biaxial Creep Data on the D-43 Alloy Stress Corrosion Reflux Capsule Test II - 1600 Hours Exposure to Potassium. Calculated Uniaxial Stress-5320 psi. Figure 8.

## V. FUTURE PLANS

## Task I Stress Corrosion Reflux Capsule Program

- A. Complete post-test evaluation of Capsule Test I including: metallographic examination, electron microprobe analysis and creep testing of machined specimens.
- B. Conclude testing of Capsule Test II.
- C. Capsule II will be drained of potassium and cleaned. Post-test evaluation will be completed in the next reporting period.

## Task II Bimetallic Isothermal Capsule Program

A. The Topical Report will be submitted to the NASA Technical Manager for approval.

## REFERENCES

- Work Performed Under NASA Contract NAS 3-2140, "Evaluation of AS-55 Alloy and Other High Strength Columbium Alloys for Alkali Metal Containment," July 25, 1962 to September 15, 1964, General Electric Company, Cincinnati, Ohio.
- DiStefano, J. R. and Hoffman, E. E., "Corrosion Mechanisms in Refractory Metal-Alkali Metal Systems," Atomic Energy Review, (1964), Vol. 2, No. 1, p 20.
- Harrison, R. W., Studies of Alkali Metal Corrosion on Materials for Advanced Space Power Systems, Quarterly Progress Report No. 4 for Period Ending July 26, 1965, NASA Contract NAS 3-6012.
- <sup>4</sup> BNL-823 (S-65), Progress Report of the Nuclear Engineering Department, May 1-August 31, 1963, Brookhaven National Laboratory, p 74.
- <sup>5</sup> Hoffman, E. E., Potassium Corrosion Test Loop Development, Quarterly Progress Report #7 for Period Ending April 15, 1965, NASA Contract NAS 3-2547, NASA-CR-54735.
- 6 DMIC Memorandum 203, "Recent Information on Long-Time Creep Data for Columbium Alloys," Columbus, Ohio.
- Harrison, R. W., Studies of Alkali Metal Corrosion on Materials for Advanced Space Power Systems, Quarterly Progress Report No. 2 for Period Ending December 26, 1964, NASA-CR-54281, NASA Contract NAS 3-6012.

## DISTRIBUTION LIST QUARTERLY AND FINAL PROGRESS REPORTS

#### Contract NAS3-6012

National Aeronautics and Space Administration Washington, D.C. 20546 Attention: Arvin Smith (RNW)

National Aeronautics and Space Administration Washington, D.C. 20546 Attention: James J. Lynch (RNP)

National Aeronautics and Space Administration Washington, D.C. 20546 Attention: George C. Deutsch (RR)

National Aeronautics and Space Administration Washington, D.C. 20546 Attention: Dr. Fred Schulman (RNP)

National Aeronautics and Space Administration Scientific and Technical Information Facility P.O. Box 33 College Park, Maryland 20740

Attention: Acquisitions Branch (SQT-34054)
(2 + Reproducible)

National Aeronautics and Space Administration Ames Research Center Moffet Field, California 94035 Attention: Librarian

National Aeronautics and Space Administration Goddard Space Flight Center Greenbelt, Maryland 20771 Attention: Librarian

National Aeronautics and Space Administration Langley Research Center Hampton, Virginia 23365 Attention: Librarian

National Aeronautics and Space Administration Manned Spacecraft Center Houston, Texas 77001 Attention: Librarian National Aeronautics and Space Administration George C. Marshall Space Flight Center Huntsville, Alabama 35812 Attention: Librarian

National Aeronautics and Space Administration Jet Propulsion Laboratory 4800 Oak Grove Drive Pasadena, California 99103 Attention: Librarian

National Aeronautics and Space Administration Jet Propulsion Laboratory 4800 Oak Grove Drive Pasadena, California 99103 Attention: Rudolph Rust

National Aeronautics and Space Administration Lewis Research Center 21000 Brookpark Road Cleveland, Ohio 44135 Attention: Librarian M.S. 3-7

National Aeronautics and Space Administration Lewis Research Center 21000 Brookpark Road Cleveland, Ohio 44135 Attention: Dr. B. Lubarsky M.S. 500-201

National Aeronautics and Space Administration Lewis Research Center 21000 Brookpark Road Cleveland, Ohio 44135 Attention: R. F. Mather M.S. 500-309

National Aeronautics and Space Administration Lewis Research Center 21000 Brookpark Road Cleveland, Ohio 44135 Attention: G. M. Ault M.S. 105-1 National Aeronautics and Space Administration Lewis Research Center 21000 Brookpark Road Cleveland, Ohio 44135

Attention: R. L. Davies M.S. 500-309 (2)

National Aeronautics and Space Administration Lewis Research Center 21000 Brookpark Road Cleveland, Ohio 44135 Attention: J. E. Dilley M.S. 500-309

National Aeronautics and Space Administration Lewis Research Center 21000 Brookpark Road Cleveland, Ohio 44135 Attention: J. J. Weber M.S. 3-19

National Aeronautics and Space Administration Lewis Research Center 21000 Brookpark Road Cleveland, Ohio 44135 Attention: T. A. Moss M.S. 500-309

National Aeronautics and Space Administration Lewis Research Center 21000 Brookpark Road Cleveland, Ohio 44135 Attention: Dr. L. Rosenblum M.S. 106-1

National Aeronautics and Space Administration Lewis Research Center 21000 Brookpark Road Cleveland, Ohio 44135 Attention: Report Control Office M.S. 5-5

National Aeronautics and Space Administration Lewis Research Center 21000 Brookpark Road Cleveland, Ohio 44135 Attention: V. F. Hlavin M.S. 3-14 (Final Only)

National Aeronautics and Space Administration Western Operations Office 150 Pico Boulevard Santa Monica, California 90400 Attention: John Keeler National Bureau of Standards Washington, D.C. 20225 Attention: Librarian

Flight Vehicle Power Branch
Air Force Aero-Propulsion Lab
Wright-Patterson Air Force Base, Ohio
Attention: Charles Armbruster
ASRPP-10

Flight Vehicle Power Branch Air Force Aero-Propulsion Lab Wright-Patterson Air Force Base, Ohio Attention: T. Cooper

Flight Vehicle Power Branch Air Force Aero-Propulsion Lab Wright-Patterson Air Force Base, Ohio Attention: Librarian

Flight Vehicle Power Branch Air Force Aero-Propulsion Lab Wright-Patterson Air Force Base, Ohio Attention: George E. Thompson APIP-1

Flight Vehicle Power Branch Air Force Aero-Propulsion Lab Wright-Patterson Air Force Base, Ohio Attention: George Sherman API

Flight Vehicle Power Branch Air Force Aero-Propulsion Lab Wright-Patterson Air Force Base, Ohio Attention: George Glenn

Army Ordnance Frankford Arsenal Bridesburg Station Philadelphia, Pennsylvania 19137 Attention: Librarian

Bureau of Mines Albany, Oregon Attention: Librarian

Bureau of Ships Department of the Navy Washington, D.C. 20225 Attention: Librarian Bureau of Weapons Research and Engineering Materials Division Washington, D.C. 20225 Attention: Librarian

U.S. Atomic Energy Commission Technical Reports Library Washington, D.C. 20545 Attention: J. M. O'Leary (2)

U.S. Atomic Energy Commission Germantown, Maryland 20767 Attention: H. Finger

U.S. Atomic Energy Commission
Germantown, Maryland 20767
Attention: H. Rochen,
SNAP 50/SPUR Project Office

U.S. Atomic Energy Commission
Germantown, Maryland 20767
Attention: Major Gordon Dicker,
SNAP 50/SPUR Project Office

U.S. Atomic Energy Commission Germantown, Maryland 20767 Attention: K. E. Horton

U.S. Atomic Energy Commission Technical Information Service Extension P.O. Box 62 Oak Ridge, Tennessee 27831 (3)

U.S. Atomic Energy Commission Washington, D.C. 20545 Attention: M. J. Whitman

Office of Naval Research Power Division Washington, D.C. 20225 Attention: Librarian

U.S. Naval Research Laboratory Washington, D.C. 20225 Attention: Librarian Advanced Technology Laboratories Division of American Standard 369 Whisman Road Mountain View, California 94040-2 Attention: Librarian

Aerojet-General Corporation P.O. Box 296 Azusa, California 91703 Attention: Librarian

Aerojet-General Corporation P.O. Box 296 Azusa, California 91703 Attention: R. S. Carey

Aerojet-General Nucleonics P.O. Box 77 San Ramon, California 94583 Attention: Librarian

AiResearch Manufacturing Company Sky Harbor Airport 402 South 36th Street Phoenix, Arizona 85034 Attention: Librarian

AiResearch Manufacturing Company Sky Harbor Airport 402 South 36th Street Phoenix, Arizona 85034 Attention: E. A. Kovacevich

AiResearch Manufacturing Company Sky Harbor Airport 402 South 36th Street Phoenix, Arizona 85034 Attention: John Dannan

AiResearch Manufacturing Company 9851-9951 Sepulveda Boulevard Los Angeles, California 90045 Attention: Librarian

Argonne National Laboratory 9700 South Cross Avenue Argonne, Illinois 60440 Attention: Librarian Atomics International 8900 DeSoto Avenue Canoga Park, California 91303 Attention: Librarian

Atomic International 8900 DeSoto Avenue Canoga Park, California 91303 Attention: Harry Pearlman

#### **AVCO**

Research and Advanced Development Program 201 Lowell Street Wilmington, Massachusetts 01800 Attention: Librarian

Babcock and Wilcox Company Research Center Alliance, Ohio 44601-2 Attention: Librarian

Battelle Memorial Institute 505 King Avenue Columbus, Ohio 43201 Attention: Librarian

Battelle Memorial Institute 505 King Avenue Columbus, Ohio 43201 Attention: Dr. E. M. Simmons

The Bendix Corporation Research Laboratories Division Southfield, Michigan 48200 Attention: Librarian

The Boeing Company Seattle, Washington 98100 Attention: Librarian

Brookhaven National Laboratory Upton, Long Island, New York 11973 Attention: Librarian

Chance Vought Aircraft, Inc. P.O. Box 5907 Dallas, Texas 75222 Attention: Librarian Clevite Corporation
Mechanical Research Division
540 East 105th Street
Cleveland, Ohio 44108
Attention: N. C. Beerli

Convair Astronautics 5001 Kerrny Villa Road San Diego, California 92111 Attention: Librarian

Crucible Steel Company of America Pittsburgh, Pennsylvania Attention: Librarian

Curtiss-Wright Corporation Research Division Quehanna, Pennsylvania Attention: Librarian

Eitel McCullough, Incorporated 301 Industrial Way San Carlos, California Attention: Leonard Reed

Electro-Optical Systems, Inc. Advanced Power Systems Division Pasadena, California 91100 Attention: Librarian

Ford Motor Company Aeronutronics Newport Beach, California 92660 Attention: Librarian

General Atomic John Jay Hopkins Laboratory P.O. Box 608 San Diego, California 92112 Attention: Librarian

General Atomic John Jay Hopkins Laboratory P.O. Box 608 San Diego, California 92112 Attention: Dr. Ling Yang

General Electric Company Atomic Power Equipment Division P.O. Box 1131 San Jose, California General Electric Company
Missile and Space Vehicle Department
3198 Chestnut Street
Philadelphia, Pennsylvania 19104
Attention: Librarian

General Electric Company Vallecitos Atomic Lab. Pleasanton, California 94566 Attention: Librarian

General Dynamics/Fort Worth P.O. Box 748 Fort Worth, Texas 76100 Attention: Librarian

General Motors Corporation Allison Division Indianapolis, Indiana 46206 Attention: Librarian

Hamilton Standard
Division of United Aircraft Corporation
Windsor Locks, Connecticut
Attention: Librarian

Hughes Aircraft Company
Engineering Division
Culver City, California 90230-2
Attention: Librarian

IIT Research Institute 10 W. 35th Street Chicago, Illinois 60616 Attention: Librarian

Lockheed Missiles and Space Division Lockheed Aircraft Corporation Sunnyvale, California Attention: Librarian

Lockheed Missiles and Space Division Lockheed Aircraft Corporation Sunnyvale, California Attention: John N. Cox

Marquardt Aircraft Company P.O. Box 2013 Van Nuys, California Attention: Librarian The Martin Company
Baltimore, Maryland 21203
Attention: Librarian

The Martin Company Nuclear Division P.O. Box 5042 Baltimore, Maryland 21220 Attention: Librarian

Martin Marietta Corporation Metals Technology Laboratory Wheeling, Illinois

Materials Research and Development Manlabs, Incorporated 21 Erie Street Cambridge, Massachusetts 02139

Materials Research Corporation Orangeburg, New York Attention: Librarian

McDonnell Aircraft St. Louis, Missouri 63100 Attention: Librarian

MSA Research Corporation Callery, Pennsylvania 16024 Attention: Librarian

North American Aviation, Inc. Los Angeles Division Los Angeles, California 90009 Attention: Librarian

Oak Ridge National Laboratory Oak Ridge, Tennessee 37831 Attention: W. H. Cook

Oak Ridge National Laboratory Oak Ridge, Tennessee 37831 Attention: W. O. Harms

Oak Ridge National Laboratory Oak Ridge, Tennessee 37831 Attention: Dr. A. J. Miller

Oak Ridge National Laboratory Oak Ridge, Tennessee 37831 Attention: Librarian Oak Ridge National Laboratory Oak Ridge, Tennessee 37831 Attention: J. H. DeVan

Oak Ridge National Laboratory Oak Ridge, Tennessee 37831 Attention: G. Goldberg

Pratt & Whitney Aircraft 400 Main Street East Hartford, Connecticut 06108 Attention: Librarian

Republic Aviation Corporation Farmingdale, Long Island, New York Attention: Librarian

Rocketdyne Canoga Park, California 91303 Attention: Librarian

Solar 2200 Pacific Highway San Diego, California 92112 Attention: Librarian

Southwest Research Institute 8500 Culebra Road San Antonio, Texas 78206

Superior Tube Company Norristown, Pennsylvania Attention: Mr. A. Bound

Sylvania Electrics Products, Inc. Chem. & Metallurgical Towanda, Pennsylvania Attention: Librarian

TRW Inc.
Caldwell Research Center
23555 Euclid Avenue
Cleveland, Ohio 44117
Attention: Librarian

Union Carbide Corporation Stellite Division Kokomo, Indiana Attention: Librarian Union Carbide Nuclear Company P.O. Box X Oak Ridge, Tennessee 37831 Attention: X-10 Laboratory

Union Carbide Nuclear Company P.O. Box X Oak Ridge, Tennessee 37831 Attention: Records Department (2)

Union Carbide Metals Niagara Falls, New York 14300 Attention: Librarian

United Aircraft Corporation Pratt & Whitney Division 400 W. Main Street Hartford 8, Connecticut Attention: W. H. Podolny

United Nuclear Corporation Five New Street White Plains, New York 10600-5 Attention: Librarian

Union Carbide Corporation
Parma Research Center
P.O. Box 6115
Cleveland, Ohio 44101
Attention: Technical Information Services

Wah Chang Corporation Albany, Oregon Attention: Librarian

Westinghouse Electric Corporation Astronuclear Laboratory P.O. Box 10864 Pittsburgh, Pennsylvania 15236 Attention: Librarian

Westinghouse Electric Corporation Astronuclear Laboratory P.O. Box 10864 Pittsburgh, Pennsylvania 15236 Attention: R. T. Begley Westinghouse Electric Corporation Materials Manufacturing Division RD#2 Box 25 Blairsville, Pennsylvania Attention: Librarian

Westinghouse Electric Corporation Aerospace Electrical Division Lima, Ohio Attention: P. E. Kueser

Westinghouse Electric Corporation Research & Development Center Pittsburgh, Pennsylvania 15235 Attention: Librarian

Wyman-Gordon Company North Grafton, Massachusetts Attention: Librarian

Grumman Aircraft Bethpage, New York Attention: Librarian

Lawrence Radiation Laboratory Livermore, California Attention: Dr. James Hadley

Lawrence Radiation Laboratory Livermore, California Attention: Librarian (2)

Allis Chalmers
Atomic Energy Division
Milwaukee, Wisconsin
Attention: Librarian

Allison-General Motors Energy Conversion Division Indianapolis, Indiana Attention: Librarian

AMF Atomics 140 Greenwich Avenue Greenwich, Connecticut Attention: Librarian

American Machine and Foundary Company Alexandria Division 1025 North Royal Street Alexandria, Virginia Attention: Librarian Douglas Aircraft Company, Inc. Missile and Space Systems Division 3000 Ocean Park Boulevard Santa Monica, California Attention: Librarian

Climax Molybdenum Company of Michigan 1600 Huron Parkway Ann Arbor, Michigan 48105 Attention: Librarian

Climax Molybdenum Company of Michigan 1600 Huron Parkway Ann Arbor, Michigan 48105 Attention: Dr. M. Semchyshen

Fansteel Metallurgical Corporation North Chicago, Illinois Attention: Librarian

National Research Corporation 405 Industrial Place Newton, Massachusetts Attention: Librarian

Varian Associates
Vacuum Products Division
611 Hansen Way
Palo Alto, California
Attention: Librarian

Ultek Corporation 920 Commercial Street Palo Alto, California Attention: Librarian

Universal Cyclops Steel Corporation Refractomet Division Bridgeville, Pennsylvania Attention: C. P. Mueller

Los Alamos Scientific Laboratory University of California Los Alamos, New Mexico Attention: Librarian

Lockheed Georgia Company Division, Lockheed Aircraft Company Marietta, Georgia Attention: Librarian